

IMPORTANT

Dodge Truck Clutch Sets

Intermittent transmission issues are known to exist on some Dodge trucks. Hard shifting may occur from Neutral to 1st, 2nd or reverse gears. This is primarily due to the large diameter and heavy-duty nature of the transmission and clutch components. Normal operation calls for a 3 to 4 second "spin down time" in which the clutch pedal needs to be depressed and held before attempting to shift the transmission out of Neutral and into gear. This spin down time is NOT usually necessary when the vehicle is in motion (shifting from gear to gear). In order to minimize this hard shifting issue, we recommend customers to check/do following during the clutch change procedure:

1. Always install a new release bearing and new pilot bearing.
2. Properly resurface or replace the flywheel.
3. Check the transmission input shaft spline and pilot bearing surfaces – replace the input shaft if it is questionable.
4. Check the transmission input shaft for excessive "play" or wobble – this could signal a worn input shaft bearing.
5. Inspect the transmission release bearing collar, release bearing arm and pivot ball stud. Replace any questionable item.
6. Use only O.E. approved transmission and hydraulic clutch fluid.
7. Follow all other Centerforce supplied tech sheets and suggested procedures.

Also, please be advised; when upgrading from an O.E. Dual-Mass type flywheel and/or to a heavy-duty clutch set, it is not uncommon to experience increased transmission gear rattle (or "roll over noise") when idling in Neutral.



"NOTE" Centerforce tip sheets are for general reference only. Please refer to your owners manual for vehicle specifications.

IMPORTANT