

NO PART OF THIS DOCUMENT MAY BE REPRODUCED WITHOUT PRIOR AGREEMENT AND WRITTEN PERMISSION OF FORD RACING PERFORMANCE PARTS.

Please contact the Tech Line for the most current instruction information (800) 367-3788


!!! PLEASE READ THE FOLLOWING INSTRUCTIONS CAREFULLY PRIOR TO INSTALLATION!!!

NOTE: Due to location of stripes over complex curves and compound curves of vehicle (especially on front/rear fascias and rear deck), it is strongly recommended you seek the services of a trained professional at your local Ford dealership to perform installation of stripe package.

MISSING/DAMAGED PARTS POLICY:

All claims for missing and/or damaged parts must be made PRIOR to installing ANY of the stripes upon the vehicle and within 30 days from receipt of parts, with proof of purchase. Please remove contents of box and cross-reference to parts list/layout, provided below, and immediately report any damage. Damaged/missing parts claims can only be processed by re-packing all of the contents of box and contacting the manufacturer at 800-472-8990.

2005 Ford Mustang GT - 10" Stripe, 1.75" Void

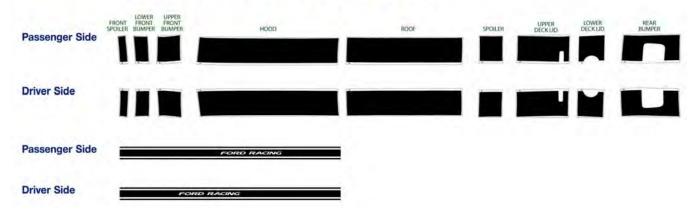

INSTALLATION INSTRUCTIONS:

STEP 1: Remove contents of box and inspect to ensure that entire stripe package has been included and none of the pieces have been damaged in shipping.

STEP 2: Contact your local Ford Dealer to employ the services of a professional installer.

Tech Line (800) 367-3788



NO PART OF THIS DOCUMENT MAY BE REPRODUCED WITHOUT PRIOR AGREEMENT AND WRITTEN PERMISSION OF FORD RACING PERFORMANCE PARTS.

STEP 3: Prepare vehicle surface for installation as follows:

Vehicle surface temperature must be a minimum of 60 degrees F, clean and free of oil, wax, grease or any foreign matter including edges where graphics will be rolled under. PPG DX 330, R&H Pre-Cleaner, Dupont Prep-Sol 3919 or any other good quality paint preparation solvent MUST be used to clean surface prior to installing graphics. Be sure to re-wipe surfaces after solvent dries to remove any haze or residue.

STEP 4: Locate and mark center of vehicle on hood, roof, rear deck and front/rear fascias (if choosing to install fascia stripes) with tape and pen marks.



STEP 5: Align stripes on hood by using holes cut for window washers and center marks placed at front of hood. Liner/backing of stripes should line up to each other as shown below.



STEP 6: After aligning hood stripes, tape and "hinge" one side of stripe in place and install to hood as shown below. Repeat for other side using liner/backing and window washer holes for alignment. Ends of stripes at front and rear of hood should be rolled under edges and securely adhered.







Tech Line (800) 367-3788



NO PART OF THIS DOCUMENT MAY BE REPRODUCED WITHOUT PRIOR AGREEMENT AND WRITTEN PERMISSION OF FORD RACING PERFORMANCE PARTS.

STEP 7: Repeat same steps for roof stripes by first aligning, taping in place then installing using the "hinge" method. Excess stripe on ends at window/roof edges needs to be trimmed using a sharp utility/ X-acto blade and a steady hand ensuring NOT to cut paint on vehicle.



STEP 8: Rear Deck Stripes.

<u>NOTE</u>: For ease of and proper installation, we recommend the removal of the rear deck spoiler prior to installing stripe. This should be done by your Authorized Ford Dealer and/or installer.

STEP 9: Start the rear deck by first taping the lower, rear stripes in place and then the upper deck stripes to ensure proper alignment. Once taped in place and reference marks have been made, remove upper deck stripes and begin by installing the lower/rear deck stripes, again using the "hinge" method, then proceed onto the upper deck stripes. Upper deck stripes should align with and overlap the lower deck stripes by approx. 1/8". Excess stripe on front and lower edge of trunk should be rolled in and

securely adhered.







STEP 10: Re-install and secure rear deck spoiler and use existing stripes on rear deck to visually align stripes on spoiler. Tape pieces in place and repeat the same "hinge" installation method. Roll excess under edge and secure.



Tech Line (800) 367-3788



NO PART OF THIS DOCUMENT MAY BE REPRODUCED WITHOUT PRIOR AGREEMENT AND WRITTEN PERMISSION OF FORD RACING PERFORMANCE PARTS.

STEP 11: Rear Fascia/Bumper Stripes.

Follow same procedure by taping stripes in place and using the "hinge" install method. Bottom of stripes are difficult to install and will require some finish trimming on vehicle.



STEP 12: Front Fascia/Bumper Stripes.

Follow same procedure by taping stripes in place and using the "hinge" install method. Stripes are difficult to install and will require some finish trimming on vehicle.

After aligning all stripes, install bumper center sections, upper sections and then lower/splitter sections.



STEP 13: Left/Right Bodyside Stripes.

Follow same procedure by taping stripes in place and using the "hinge" install method.



Tech Line (800) 367-3788