

INSTALLATION INSTRUCTIONS FOR PART 99-30105

APPLICATIONS 2010 CHEVY CAMARO 99-30105


KIT FEATURES

- DIN Head Unit Provision w/ Pocket
- ISO DIN Head Unit Provision w/ Pocket
- DDIN Head Unit Provision
- ISO Stacked Head Unit Provision
- Painted Silver to Match Factory Dash



KIT COMPONENTS

- •A) Radio Trim Panel •B) Radio Housing •C) ISO Brackets •D) ISO Trim Plate
- •E) DDIN Brackets •F) DDIN Trim Plate •G) Pocket •H) Interface •I) 20 Pin GM Harness
- •J) 4 Pin Harness w/ Stripped Leads •K) 22 Pin to 44 Pin Camaro Harness
- •L) 18 Pin to 10 Pin HVAC Harness
- •M) Female 3.5mm Connector w/ Brown and Brown/White Wires •N) (2) Panel Clips

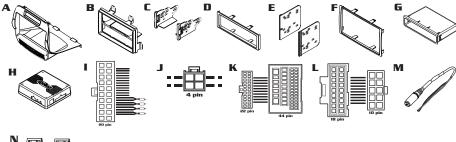



<u>WIRING AND ANTENNA CONNECTIONS (sold separately)</u>
•40-EU10 European Antenna Adapter 2006-UP

TOOLS REQUIRED

- Phillips Screwdriver Panel Removal Tool Small Flat Blade Screwdriver
- Socket Wrench Tape Crimping Tool Connectors (i.e. Butt Connectors)





TABLE OF CONTENTS

DASH DISASSEMBLY
• CHEVY CAMARO 2010 1-3
KIT PREPARATION
• CHEVY CAMARO 2010
KIT ASSEMBLY
CHEVY CAMARO 2010
• DIN HEAD UNIT PROVISION
• ISO DIN HEAD UNIT PROVISION 6
• DDIN/STACKED ISO DIN HEAD UNIT PROVISION 7
IINTERFACE WIRING
• CHEVY CAMARO 20108-18

*NOTE: Refer Also to the instructions included with the aftermarket radio.



KNOWLEDGE IS POWER Enhance your installation and fabrication skills by enrolling in the most recognized and respected mobile electronics school in our industry. Log onto www.installerinstituc.com or call 800-536-6782 for more information and take steps toward a better tomorrow.




Metra recommends MECP certified technicians


CHEVY CAMARO 2010

- Disconnect the negative battery terminal to prevent an accidental short circuit.
 - For vehicles without UMQ gauge panel, unsnap and remove shifter trim panel and skip to step 10.
- Unclip and remove the (2) side trim panels running the length of the center console. (Fig. A)
- **3** Remove (1) Phillips screw from each side of the front of the center console. (Fig. B)
- Remove (2) Phillips screws per side from the cover on the back of the center console then unclip and remove the cover. (Fig. C)


A

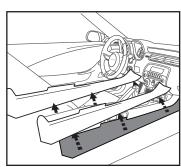

В

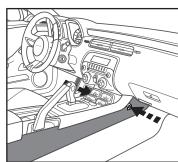

C

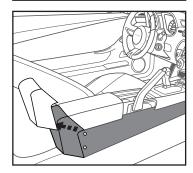


Continued on Pg. 2





99-30105 DASH DISASSEMBLY

CHEVY CAMARO 2010

- Femove (2) Phillips screws exposed under the cover on the back of console. (Fig. D)
- Remove T20 from front of shifter on Auto Trans., remove shifter.
- **7** Remove gauge cluster / trim panel around shifter. (Fig. E)
- Remove shifter surround panel, (4) 7mm bolts, unclip each side and lift up. (Fig. F)

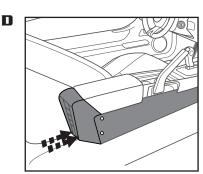

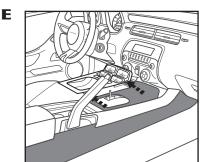


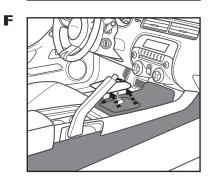





CHEVY CAMARO 2010

- Lift up on the rear of the console and slide toward the back of the vehicle then unclip and remove the entire center console. (Fig. G)
- 10 Remove (2) 9/32" screws securing the climate control/radio trim panel and remove. (Fig. H)
- **11** Remove (4) Phillips screws securing the radio chassis. (Fig. I)
- 12 Reassemble parts together from steps 7-9 and reassemble as one unit after radio installation.

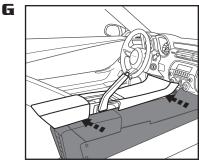

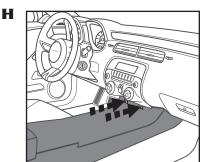

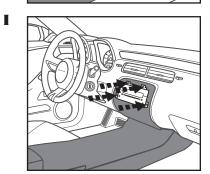

Continue to Kit Preparation