

THE NEXT GENERATION OF FOLDING TONNEAU COVERS.

Model Specific Install Guide


GM Applications

Chevy Silverado / GMC Sierra 2014 - Current 5.7' Bed - FX11018 6.5' Bed - FX11019 Chevy Silverado / GMC Sierra 2007-2013 Without Cargo Management System - With factory bed caps 5.7' Bed - FX11006

6.5' Bed - FX11009

1 Hardware Kit Check List

- **A.** Clamp Kit(6)
- B. Star Knobs(2)
- **C.** Front Retainer Clamp(2)
- **D.** Front Mounting Bolts
- (2) Lock Washer (2), Flat Washer (2)
- E. Rubber Filler Strips (4, for use on 6.5' GMC only)

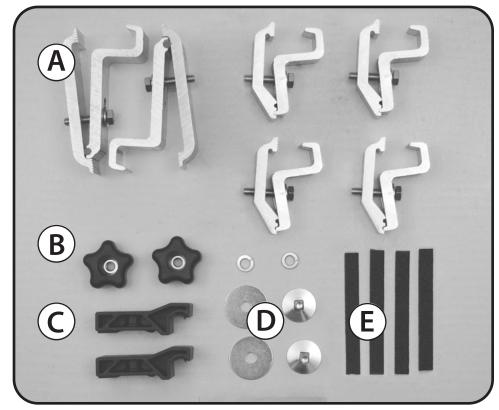

KIT - X



Form # FL71-X Modified July 2013 For Warranty Issues, Contact UnderCover Directly (866) 900 8800 www.flex-cover.com



MODEL SPECIFIC GUIDE GM Applications

2 Attach Side Mounting Rails

Attach both left and right side rails to the truck bed. The end of the mounting rail with the drain tube fitting will go towards the cab of the truck.

For GMC 6.5' Beds Only - Stick the rubber spacers between the plastic bed rail cap and the bed rail, adjacent to the front and center clamps. (Identify the location of the spacers by holding the mounting rail up to the bed rail of the truck and marking the location of the clamps on the truck. Pull out on the plastic bed rail cap and slide the the spacer in, sticking it to the truck bed.)

Position the top edge of the mounting rail flush to 1/8" above the top edge of your truck bed rail, Figure 1 & 2. Starting with the center clamp (one of the smaller clamps) install the rail, but do not tighten completely. Install the other small clamp towards the front of the rail. Install the larger clamp at the rear of the rail, place the back portion of the clamp into the stake pocket, Figure 3. Tighten the clamps using a 1/2" wrench or socket, Photo A.


Note: If you discover your truck will not allow you to position a clamp adjacent to the spacer, simply slide the spacer forward or back as needed.



Warning! Do not overtighten the clamp assembly. A torque wrench is not necessary. If preferred, torque is apx 120 inch lbs.




Warning! Clamps must be checked periodically for tightness. Failure to do so could result in damage to you or your property.

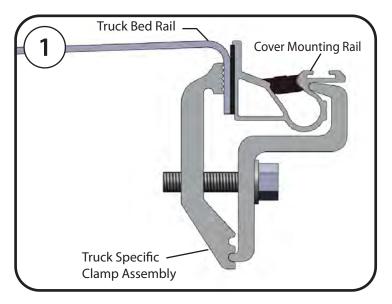





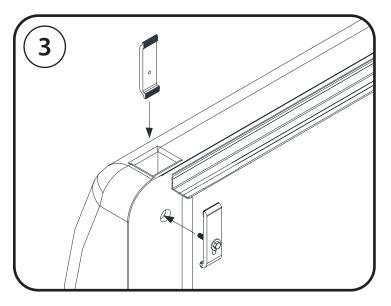

UnderCover, Inc. P.O. Box 620 Rogersville, MO 65742 (417) 753-8000 (866) 900-8800

www.undercoverinfo.com sales@undercoverinfo.com