

### Vehicle Application

•All Jeep CJ5s, CJ7s and Wranglers 1976 – 2006 Vinyl Seat

•All Jeep CJ5s, CJ7s and Wranglers 1976 – 2006 Cloth Seat

1997 – 2002 Vehicles must use Adapter Bracket Part Number 51256. 2003 – 2006 Vehicles must use Seat Slider 51245 (Left) and 51248 (Right)

www.Bestop.com - We're here to help! Visit our web site and click on <u>"Ask a Question"</u>. Click here for more <u>Jeep Accessories by Bestop</u>.



**WARNING** This product is designed primarily to enhance the appearance of the vehicle and to shield the occupants from ordinary weather conditions. Do not rely in any way on the components of this product to contain occupants within the vehicle, or to protect against injury or death in the event of an accident. This product will not protect the occupants from falling objects. Never operate the vehicle in excess of manufacturer's specifications.

#### WEAR SEAT BELTS AT ALL TIMES


Read and follow, precisely, all installation instructions provided when installing product. Failure to do so may result in a poor fit and could place occupants of the vehicle in a potentially dangerous situation.

© 2017 Bestop, Inc.

# TrailMax<sup>™</sup> II Pro Reclining High Back Bucket Seat – Installation Instructions

### Parts List and Hardware Identification





Parts Kit, Part #566.45 - Left (shown) Parts Kit, Part #566.44 - Right (not shown)



Before beginning the seat installation, set the park-

ing brake, place the vehicle in gear or park and chock the wheels to reduce the risk of the vehicle unexpectedly moving, which could result in serious injury.



The seat is designed to be installed on the original seat riser. DO NOT remove or loosen any


of the original seat riser anchor bolts. Doing so may cause improper anchoring of the seat, which could result in serious injury, to you and others.

# **1** Remove the Existing Seat from the Vehicle

Remove the four (4) nuts that mount the seat track slides to the riser. Do not throw away the four (4) nuts since they will be reused.

The nuts are under the ledge on the riser.


Then remove the bucket seat and track slides from the vehicle (the seat riser will remain in the vehicle).

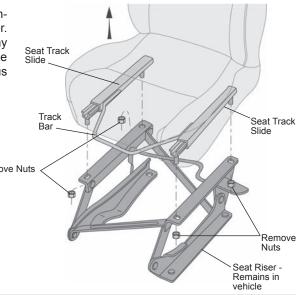

**WARNING** DO NOT reuse the original mounting bolts. Reuse of the bolts could cause the seat to loosen, which could result in loss of control of the vehicle, causing bodily injury to the vehicle occupants and to others.

### Remove the Tracks

Lay the seat down with the bottom side facing up. Push down on the track bar to slide the track forward, allowing access to the rear track mounting bolts. Remove the bolts and discard them.

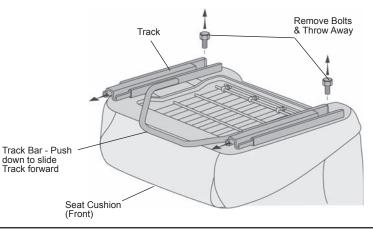

Rev. E 1217 pg. 2


© 2017 Bestop, Inc.

### TrailMax<sup>™</sup> II Pro Reclining High Back Bucket Seat – Installation Instructions

### Remove the Tracks


Push down on the track bar again to slide the track toward the rear of the seat. Remove the front track mounting bolts and discard them.

Do not throw away the tracks, they will be mounted to the Bestop seat.

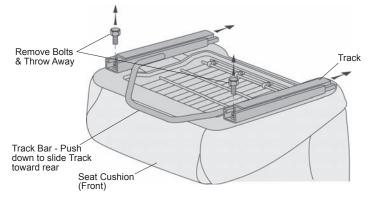

#### **Hole Pattern**

Your new Bestop seat has two (2) mounting holes on each side of the front and three (3) holes on each side of the rear. This allows tracks from various Jeep models to be used with the Bestop seat. Locate the correct mounting pattern by placing the track on the seat and positioning the track so that the four holes in the track align with four mounting holes in the seat, allowing the track to be positioned in the center of the seat.

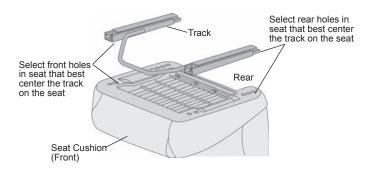


**WARNING** Use only the bolts provided in the Parts Kit when installing the new seat. Failure to do so may cause the seat to loosen, resulting in loss of control of the vehicle and causing serious bodily injury to the vehicle occupants and to others.


### Install the tracks on the Bestop Seat

Lay the Bestop seat down with the bottom of the seat facing up. Select the hole pattern on the seat that applies to your vehicle.

While the track slides are to the rear of the seat, place the tracks onto the Bestop seat. Install two of the M8-1.25x25 Bolts from the Parts Kit in the front track mounting holes. Finger tighten the bolts.

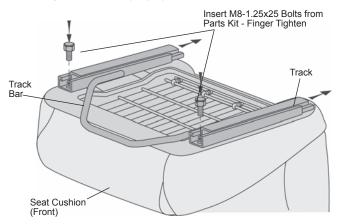


# TrailMax<sup>™</sup> II Pro Reclining High Back Bucket Seat – Installation Instructions

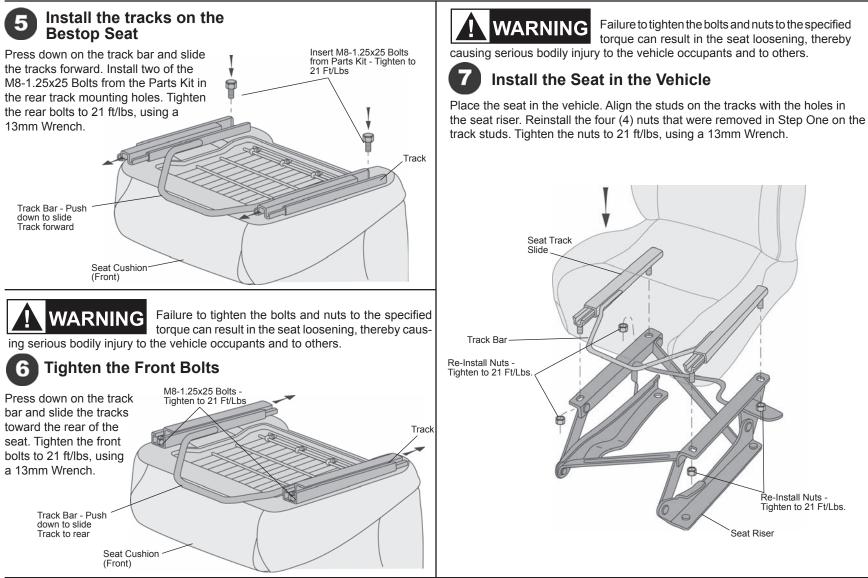

Rev. E 1217 pg. 4

© 2017 Bestop, Inc.

# TrailMax<sup>™</sup> II Pro Reclining High Back Bucket Seat – Warranty Information

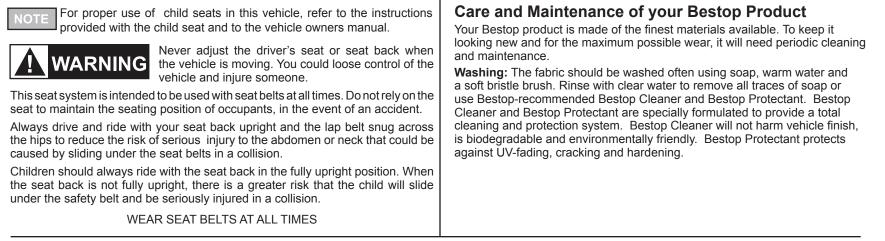

#### WHAT BESTOP WARRANTS

Subject to the terms and conditions of sale, including any terms and conditions set forth by Bestop, Inc. ("Bestop" or "us" or "we") in our then-current terms of sale on our website (collectively, the "Terms"), Bestop represents and warrants that: the covered products listed in the "Covered Products and Warranty Periods" section (a "Product") will substantially be free from defects in materials and workmanship for the specified warranty periods set forth in that section.

THE WARRANTY IS LIMITED AND CONDITIONAL

This warranty applies to the original purchaser of the Product only. The warranty is valid only as long as the original retail purchaser owns the vehicle upon which the Product is installed. The warranty expires should the Product be removed from the original vehicle or if the original vehicle is transferred to another owner. This warranty is not transferable or assignable. The warranty does not apply to Product bought from auction-style or price-bid websites.

THE LIMITED WARRANTY AND STATED REMEDIES ARE SOLE AND EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES AND REME-DIES, AND COMPANY EXPRESS DISCLAIMS ALL IMPLIED OR STATUTORY OR OTHER WARRANTIES, INCLUDING WITHOUT LIMITATIONS WARRANTIES OF MERCHANTABILITY, NON-INFRINGEMENTOR FITNESS FOR A PARTICULAR PURPOSE. IN NO EVENT WILL COMPANY BE LIABLE FOR ANY SPECIAL, INCIDENTAL, CONSEQUENTIAL, PUNITIVE, INDIRECT OR EXEMPLARY DAMAGES OF ANY KIND, INCLUD-ING LOST PROFITS OR REVENUE, HOWEVER CAUSED, WHETHER FOR BREACH OR REPUDIATION OF CONTRACT, TORT, BREACH OF WARRANTY, NEGLIGENCE, OR OTHERWISE, WHETHER OR NOT COMPANY WAS ADVISED OF THE POSSIBILITY OF SUCH LOSS OR DAMAGES.

Some states do not allow exclusion or limitation, so this may not apply to you. This warranty gives you specific legal rights, and you may have other rights which vary from state to state.

### TrailMax<sup>™</sup> II Pro Reclining High Back Bucket Seat – Warranty Information (cont.)

#### **EXCLUSIONS TO THE WARRANTY**

The Limited Warranty excludes, and Bestop is not liable in any way for any warranty claims, damages, or defects related to:

- Misuse, abuse, accidents, vandalism, negligence, fire, or improper installation or modification, or improper or inadequate maintenance;
- Failure to comply with any Product documentation, Bestop instructions, or applicable law or regulations; use in extreme conditions

• Force Majeure including but not limited to, earthquake, hurricane, tornado, flooding, or other disasters natural or man-made, civil unrest, strikes, declared or undeclared war, or lack of performance by, or discontinued product of, supply chain partners whose products, software, operations or management is beyond the control of Bestop;

• Damage resulting in breakage (including without limitation, spontaneous breakage, accidental breakage or breakage by any other means)

of a Product or any component part;

• Damage to vinyl windows due to misuse, or cracking due to varying weather conditions.

#### YOUR SOLE REMEDY

During the applicable warranty period, Bestop shall, at its option, either repair or replace any Product that it confirms, in its discretion, is non-compliant with the warranties herein. Bestop will not pay for labor charges associated with installation or removal of the Product. Should a specific Product be discontinued, Bestop may, at its option, replace the discontinued Product with a current product or like product.

Please retain your proof of purchase. Original proof of purchase for the Product must accompany any warranty claim. If you have a warranty claim, first you must email Bestop Customer Service at csbestop@bestop.com for instructions. All claims must be emailed to csbestop@bestop.com within 30 days of discovery of a defective Product, but in no event later than thirty days after the end of the applicable Warranty Period (the "Warranty Notice Period"). Warranty claims made after the Warranty Notice Period are null and void and Bestop shall have no responsibility with respect to such claims.

THIS SECTION SETS FORTH BESTOP'S SOLE OBLIGATION & YOUR SOLE REMEDY WITH RESPECT TO ANY DEFECTS OR OTHER PRODUCT ISSUE. ANY PRODUCTS REPLACED UNDER TERMS OF THIS WARRANTY WILL BE COVERED UNDER TERMS & BALANCE OF THE DURATION OF THE ORIGI-NAL LIMITED WARRANTY FOR SUCH PRODUCT.

### TrailMax<sup>™</sup> II Pro Reclining High Back Bucket Seat – Warranty Information (cont.)

**COVERED PRODUCTS AND WARRANTY PERIODS:** The warranty time periods are as follows for Products manufactured by Bestop:

#### **BESTOP® LIMITED LIFETIME WARRANTY**

Trektop® Pro Twill Fabric Top Sunrider® for Hardtop Twill Fabric Top Trektop® NX Glide Twill Fabric Top Replace-a-Top™ Twill Fabric Top Trektop® NX Twill Fabric Top Supertop® NX Twill Fabric Top EZFold™ Soft Tonneaus Floor & Cargo Liners ZipRail™ Soft Tonneaus Pet Barriers EZRoll™ Soft Tonneaus

#### **BESTOP® 5-YEAR LIMITED WARRANTY**

Trektop® NX Glide<sup>™</sup> Top (non-Twill) Sunrider® for Hardtop (non-Twill)Replace-a-Top<sup>™</sup> Top (non-Twill) Trektop® NX Top (non-Twill) Sailcloth Replace-a-Top<sup>™</sup> Supertop® NX Top (non-Twill) Tigertop<sup>™</sup> and Halftop<sup>™</sup> Supertop® Classic Soft Top Sunrider® Complete Soft Top Supertop® for Truck EZ Fold Hard Tonneau

#### **BESTOP® 3-YEAR/100K MILES LIMITED WARRANTY**

Powerboard® & Powerboard® NX Trekstep®, Side Mount Trekstep®, Rear Mount

#### **BESTOP® 2-YEAR LIMITED WARRANTY**

Trektop® Classic Soft Top RoughRider™ Soft Storage

#### BESTOP® 1-YEAR LIMITED WARRANTY All other Bestop® & Pavement Ends™ products not specified above.

#### **BESTOP® 3-YEAR LIMITED WARRANTY**

Pavement Ends Sprint Top

For further information or request for warranty work, please contact: Bestop Inc. Customer Service Toll-Free: (800)845-3567 Main: (303)465-1755 E-mail: csbestop@Bestop.com Website: www.Bestop.com